

Civil Aviation Administration

Control sector's of elevator of YAK-52 aircraft check

2000 May the 1<sup>st</sup> Nr. CAI-TSD-007/2000

VALID: for all series YAK-52 aircraft.

During the aircraft YAK-52 inspection performed at Co "Termikas" Ltd., crack found in the elevator control sector. Length of the crack is approximately 19cm and goes along the part (P/N 525100-80-3).

Aircraft data:

TTSN – 936 hrs 15min.

TSOH – 10 hrs 50 min.

2 OHs carried out.

MAIN GOAL: to check the elevator control sector's crack's place.

DATE OF VALIDITY: immediately after receiving this AD.

PERFORMING: a) remove the stabilizer fairings,

b) clean, means remove old paint and price from the sector (P/N 525100-80-3) in the place of the crack,

c) check with magnifying glass (x10) cleaned surface.

If there are doubts about possible crack, check using the paint method once more.

If the AD is not performed on the aircraft, it is forbidden to fly with the aircraft.

Entry about this AD performed should be entered into the log book section XII.

Director

A. Sumskas